


Item 204400

# Assembly instructions

## PROTOS® Set Lupine Piko R 4SC

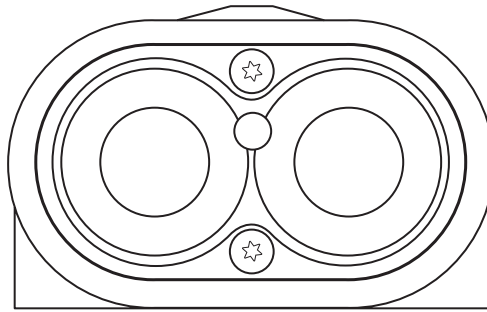

PROTOS® Lupine Piko R 4SC  
with lamp connection cable



PROTOS® Lupine  
headband rail mount  
Item 204404



Lupine 3.5 Ah / 25 Wh  
SmartCore FastClick Akku  
Item 204401



PROTOS® Lupine battery holder  
Item 204406



Lupine Wiesel charger  
Item 204402



PROTOS® Lupine anti-glare protection  
Item 204405



Lupine Bluetooth  
remote control V2  
Item 204408



PROTOS® Lupine tool kit




Lupine Peppi V5  
handlebar mount  
Item 204409



Lupine wrist strap holder  
for remote control  
Item 204407

- ① Hook the PROTOS® Lupine headband rail mount onto the front of the inner shell of the PROTOS® at the top centre, then snap it into place at the bottom of the headband rail («click»).
- ② Insert the PROTOS® Lupine Piko R 4SC with the lamp connection cable into the headband-rail mount (the on/off switch must face downwards) and secure it using the supplied screws and an Allen key.
- ③ Route the lamp connection cable beneath the visor carrier towards the rear.
- ④ With the ventilation slider open, snap the PROTOS® Lupine battery holder into place at the bottom rear edge of the PROTOS® («click») and hook it into the designated ventilation slots. Close the ventilation slider.

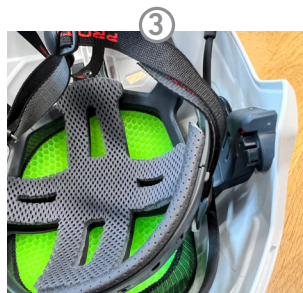

- ⑤ Connect the Lupine 3.5 Ah / 25 Wh SmartCore FastClick battery to the lamp connection cable.
- ⑥ The Lupine 3.5 Ah / 25 Wh SmartCore FastClick battery can be inserted from below into the mounted PROTOS® Lupine battery holder.
- ⑦ To work with the PROTOS® visor closed, the PROTOS® Lupine anti-glare shield is required. This can be easily slipped over the PROTOS® Lupine Piko R 4SC.

#### Removing the PROTOS® Lupine battery holder:

- ⑧ Disconnect the lamp connection cable. Press the Lupine SmartCore FastClick battery downwards and remove it. Open the ventilation slider. Carefully unclip it at the top and then slide it sideways at the bottom.



The PROTOS® Lupine Piko helmet lamp cannot be mounted if the PROTOS® is equipped with PROTOS® safety goggles; these must be removed beforehand.

**PROTOS®**  
integral